Elaho Echoflex Interface

Product Line: Elaho-Echoflex Interface

Description: Version 3.3.6 firmware

Elaho-Echoflex Interface Components

Elaho-Echoflex Interface Firmware	3.3.6.961
Echo Protocol	3.3.6.961
Radio firmware	902_1013

Effective Date: 2022-02-10

Purpose

This release corrects a software defect related to busy communications causing wireless controllers to miss an off command.

For any questions relating to the contents of this release or the behavior of this software, please contact Echoflex Solutions using the information at the bottom of this page.

Availability

This firmware is currently available in all shipping units and can be upgraded in the field using microSD media. New versions of firmware can be downloaded from ETC UpdaterAtor software. See *Firmware Installation Instructions on page 3* for details.

Documentation

Current documentation for the Elaho-Echoflex Interface includes the ElahoAccess App integrated help system.

Please keep this release note with your installation guide for descriptions of the newest features, changes, and bug fixes. Manuals are in portable document format (pdf) and are available for download at echoflexsolutions.com.



Elaho-Echoflex Interface v3.3.6

Compatibility

For questions regarding compatibility, please contact Echoflex Solutions Technical Services.

Compatible Elaho Products

This release is interoperable with the following Elaho hardware and software/firmware:

Product	Earliest Device Compatibility	Optimal Feature Compatibility
ElahoAccess App-iOS*	v1.0.0	v3.3.1
ElahoAccess App-Android*	v1.0.0	v3.3.0
ElahoAccess Interface	v1.0.0	v3.3.4
Elaho Expansion Bridge	v1.0.0	v3.3.6
Elaho BACnet Interface	v3.0.0	v3.3.6
Elaho Integration Interface	v3.3.1	v3.3.6
ElahoTouch	v3.0.0	v3.1.1
Elaho DMX Scene Controller	v1.0.0	v3.3.4
Elaho-Echoflex Interface	v1.0.0	v3.3.6
Elaho Contact Input Interface	v1.0.0	v3.3.4
Echoflex wireless devices	902 MHz radios	902 MHz radios
Elaho Contact Output Interface	v1.0.0	v3.3.4
Elaho Demand Response Interface	v2.0.0	v3.3.4
Elaho Responsive Controls	v1.0.0	v3.3.4
Elaho Dual Tech Occupancy and Vacancy Sensors	v1.0.0	v3.3.4
Elaho Dual Tech Switch-mount Occupancy Sensor	v1.0.0	v3.3.4
Elaho Room Controller - Gen2	v1.0.0	v3.3.4
Elaho Zone Controllers - Gen2	v1.0.0	v3.3.4
Elaho Inspire Stations	v3.0.0	v3.3.4
Elaho Keyswitch Stations	v3.2.0	v3.3.4
Elaho TimeClock	v1.0.0	v3.3.5
Elaho Preset Stations	v3.0.0	v3.3.4
Elaho Relay Panels	v1.0.0	v3.1.3
*The ElahoAccess App cannot configure the Elaho-Ech	oflex Interface.	

Key Enhancements in v3.3.6

• Bug fix

Key Enhancements in v3.3.5

• Bug fix

Key Enhancements in v3.3.4

• Incorporates improvements from newer Echo Protocol versions

Key Enhancements in v1.1.2

• Bug fix

Elaho-Echoflex Interface v3.3.6

Key Enhancements in v1.1.1

- Updated radio firmware
- Bug fixes

Initial Features in v1.1.0

- Supports 35 linked wireless devices
- Configuration settings for occupancy auto-on versus manual-on
- Bug fixes

Firmware Installation Instructions

The Elaho-Echoflex Interface ships with the current version of firmware installed and will not require an update before use. Existing hardware can be field upgraded using a microSD card. New firmware for the Elaho-Echoflex Interface is available through ETC UpdaterAtor software.

Update Firmware

1. To update the Elaho-Echoflex Interface firmware, you must first prepare a compatible microSD card with the firmware update file. The firmware update file, labeled EAB_FW.efw, must reside on the root of the media.




Note: Compatible cards include SDHC microSD media up to 32 GB, formatted to FAT32. SDXC is not compatible.

2. Insert the compatible microSD media into the microSD card slot located on the bottom edge of the Elaho-Echoflex Interface.



Note: The microSD card must be installed into the card slot with notched edge directed right.

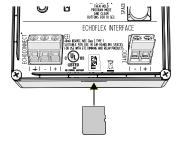

3. Cycle power to the unit. The INPUT STATUS, LEARN/TEACH, and PROGRAM MODE LEDs flash to indicate the update process has begun. After several seconds, the OUTPUT STATUS LEDs illuminate to indicate the progress of the update.



Note: Do not remove the microSD media until the LEDs are no longer flashing.

4. When the process is complete, the LEDs stop flashing and the unit restores to normal operation. Remove the microSD card.

View the current version information for the device using the ElahoAccess App. See the ElahoAccess App integrated help system for details.

Elaho-Echoflex Interface v3.3.6

Issues Corrected in v3.3.6

EEI-47143 In busy systems zones 3 and 4 are missing off messages and wireless controllers connected to those zones are not turning off.

Known Issues Remaining in v3.3.6

EEI-38466 EEI wink only winks device outputs associated with wireless outputs
EEI-34687 Wireless control input is lost when Echo bus is down or disconnected

Issues Corrected in Echo Protocol v3.3.6

EC-47215 Presets recorded from Paradigm through EEB always include Space 1

Known Issues Remaining in Echo Protocol v3.3.6

EC-47174	Two hosts with the same color temperature zone patched can result in alternating color temperature indication
EC-47116	Space Toggle button on Inspire station not affected by level of ET channel not patched to zone
EC-47111	Zone/Preset/Sequence status can "flutter" very occasionally due to a receiving host timer rollover
EC-47077	Multi-space off button occasionally flashes on when sequence is still playing
EC-47074	Off actions using timing from an active preset rather than the 2 second standard
EC-47070	Mobile app shows sequences active for sequences 2-4, not just 1
EC-47063	Multi-space hosts maintain preset status in previously-patched spaces
EC-46888	Late joining occupancy sensor controls will assert their configured occupancy action even if associated group was already in occupied state
EC-45629	Hold event configured with fade time for "set to color" actions fades intensity on hold
EC-45596	Differing space/zone levels across bridge segments causes station indication to bounce between values
EC-45462	"Uncombine All" may not uncombine all combined spaces on full Echo bus.
EC-45202	Editing spaces affected by a Demand Response input momentarily sets spaces to false during true condition
EC-44495	Products with Power on behavior can show active zone levels and activated Off status at same time
EC-44432	Manual control from non native space does not trigger occupancy when occupancy action is multi-space
EC-44154	Occupancy groups, vacancy inhibit, and photo inhibit do not support all spaces of a multi-space action
EC-43350	Accessing the Config page on multiple simultaneous mobile app connections causes duplicate devices to be listed
EC-43262	Vacancy action Preset activate can be missed after a grace restore has been triggered due to support for older Occupancy sensors
EC-43138	On occasion large batches of patch config messages can fail to transmit correctly resulting in skipped addresses
EC-43020	When two presets are active in the same space, preset indication toggles between both presets
EC-42572	Unable to toggle sequence off from combined space that does not possess a sequence enabled output product
EC-42401	Space Combine Toggle won't uncombine spaces without any host output products
EC-38851	Late joining bridge results in oscillating mismatched Zone values if different segments have different values for same zones
EC-38839	Late joining bridge results in oscillating mismatched statuses if different segments have different status for same spaces
EC-38694	Zone status does not zero out after last output product for that zone changes to new space
EC-35126	Space toggle when Zones are not at full sets Zones to 0 rather than all at full
EC-34543	Sequence indicator toggles state rapidly when output device with sequence active late joins Echo bus with output device that has inactive sequence
EC-28417	Station activity during sync period following connection of late joining output product incorrectly does not cause LED chase